

Unresolved - known anomalies

#	Subject
900	store to SD / Acknowledge images will not work when image rate is too high due to system limitations (ram , write to sd speed) max number of images which can be buffered is 5. Following will be dropped/ not written to sd
960	Entering an wifi client SSID using certain characters might not be usable (e.g . , -)
978	If WLAN is disabled in the active configuration it is not possible to change WLAN setting for any configuration. Workaround is to activate a configuration with enabled WLAN
1123	XRPad WiFi can not be configured for Outdoor usage. Indoor-only channels are offered. Customer has to ensure that no forbidden channel is used outdoors.
1492	wDummy variable within CHwHeaderInfoEx struct (which is used in XISL API) is used to retrieve the SP6 FW subrevision although its name is deceptive
1590	Acquisition_GbIF_GetConnectionSettings and Acquisition_GbIF_GetDeviceParams will return 0 as the current boot options (LLA/DHCP/STATIC) independent from the current settings
1591	"Acquisition_GetHwHeader()" is exported in "Acq.h" and function description needs to be updated
1607	Nr scrubs changed in post offset mode for XRpad2 4343. NrScrubs passed via API call will be reduced by 1